



SCUBAPRO®

#274

Engineering Bulletin

May whatever, 2002

MK25 adjustment: minor improvement

Referring to the drawing below, we have added two parts to the MK25 intermediate adjustment components. The change is now to be found both in the assembled regulators and in the MK25 adjustment kit (PN 41.300.010 and 41.300.020). The parts that were added are:

1 each O-ring P/N 01.050.147

1 each Washer P/N 01.060.220

This modification is meant to address the remote possibility of water drops entering through the threads between the seat retainer and the adjustment screw and thus, in the case of the MK25UL only, to form some oxidation (figure 1). For consistency, the change is extended to the entire line. With the new parts, o-ring (O) and washer (W) (fig. 2), the area in question is sealed and dry.

Important : only one washer (the thicker one) has to be placed under the seat retainer (to compensate for the thickness of the new o-ring).

Fig. 1


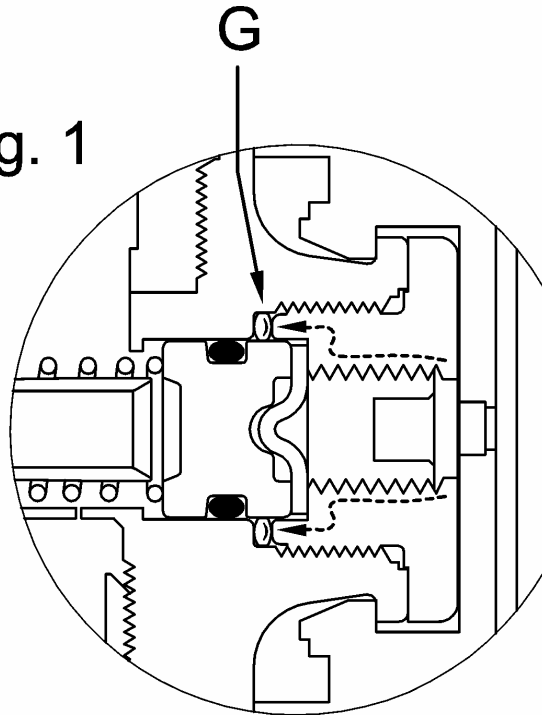


Fig. 2

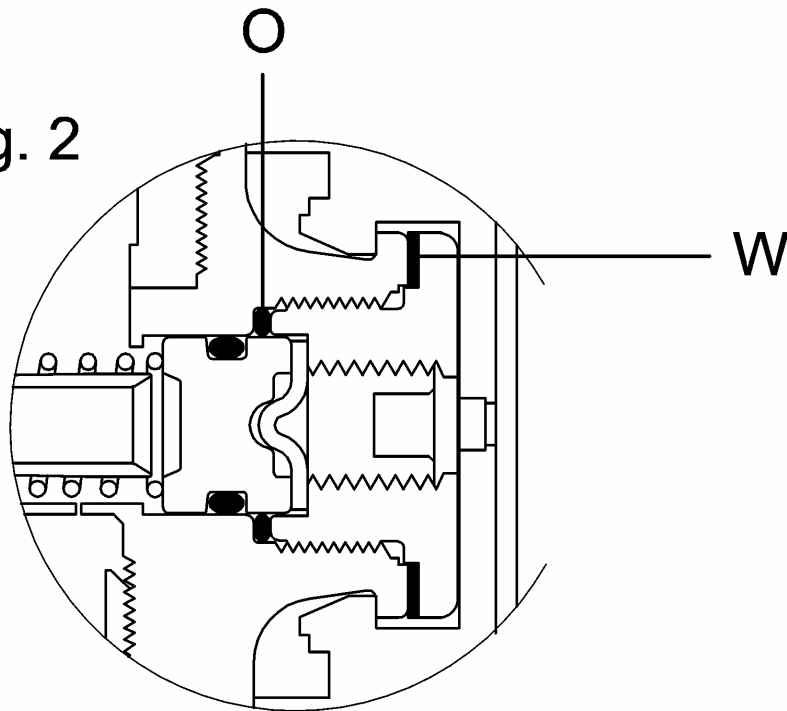

If you have any additional questions, please contact:

SCUBAPRO Technical Services
1-800-382-2211